

COFFING[®]

HOISTS

PO Box 779
Country Club Rd.
Wadesboro, NC 28170 USA

Phone 800-477-5003
Fax: 800-374-6853



WARNING



Important: Product Safety & Recall Notification

To: Grainger purchasers of Dayton Models 3YB72, 3YB73, 3YB74, 3YB75, 3YB76, 3YB77, 3YB78, 3YB79, 3YB80, 3YB81, 3YB82, 3YB83, 3YB84, 3YB85, 3YB86, 3YB87, 3YB88, 3YB89, 3YB90, 3YB91, 3YB92, 3YB93, 3YB94, 3YB95, 3YB96, 3YB97, 3YB98, 3YB99 3YE10, 3YE11, 3YE12, 3YE13, 3YE14, 3YE15, 3YE16, 3YE17, 3YE18, 3YE19, 3YE20, 3YE21, 7E989, 7E990, 7E991, 7E992 Electric Chain Hoists produced by Coffing Hoists are equipped with chain strippers that may allow the chain to become cross-linked when entering the hoist, causing the chain guide to split and jam into and ultimately break the housing. In the two-ton capacity models, this could result in the load dropping.

Use of these hoists may result in serious personal injury or property damage.

To avoid injury:

- Immediately removed all models electric chain hoists listed above from service.
- Return the subject hoists as directed below for necessary repairs, inspection and testing.

Coffing Hoists has become aware of a possible problem with the GJLC series of electric chain hoists (Dayton SKU# 3YB72 through 3YB99; 3YE10 through 3YE15; and 3YE16 through 3YE21). There are two groups of affected hoists: the two-ton capacity models and all others of less than two-ton capacity. In both groups, if the cross-linking occurs, the chain guide is split and forced into the housing causing it to fracture. In the two ton capacity models, as the secondary point of support is at the chain stripper, if the chain becomes cross linked causing the housing to become fractured, the load could become detached and drop. With the units of under two-ton capacity, this situation causes the hoist to jam and not function, possibly creating a dangerous condition. Accordingly, **all Dayton Models 3YB72 through 3YB99; 3YE10 through 3YE15; And 3YE16 through 3YE21 electric chain hoists should be immediately taken out of service and returned for repairs, as instructed below.**

If the unit is in service the unit will need to taken down and shipped to closest Coffing Hoists Warranty Service Center to have the Chain Stripper replaced. The Coffing Service Center will replace the chain stripper, inspect, and/or load test the hoist as needed before returning the hoist back to your location, at no cost to you. Coffing Hoists will reimburse or pay for shipping cost of the hoist(s) to the closest service center, shipped ground transportation. Simply invoice or send a copy of the freight bill to Coffing Hoists PO Box 779 Wadesboro, NC 28170; please mark the envelopes Attn Chain Stripper Replacement. Please include the serial number and model number of the unit or units being shipped.

The following Models Numbers and Serial Number Date Codes are located in the hoist information tag located on the body of the hoist

List of Dayton Model Numbers Shipped Feb. 1, 2004 to May 7, 2004:

3YB72, 3YB73, 3YB74, 3YB75, 3YB76, 3YB77, 3YB78, 3YB79, 3YB80, 3YB81, 3YB82, 3YB83, 3YB84, 3YB85, 3YB86, 3YB87, 3YB88, 3YB89, 3YB90, 3YB91, 3YB92, 3YB93, 3YB94, 3YB95, 3YB96, 3YB97, 3YB98, 3YB99

3YE10, 3YE11, 3YE12, 3YE13, 3YE14, 3YE15, 3YE16, 3YE17, 3YE18, 3YE19, 3YE20, 3YE21, 7E989, 7E990, 7E991, 7E992

With the following Date Codes:

NT, PT, QT, RT --- Example of a Hoist Serial Number --- JM0101NT

Please make sure this notice is forwarded to the end user of the subject product.

If you have questions regarding this issue please call 704-694-2156 or fax 800-374-6853. We apologize for any inconvenience to you and thank you for your immediate attention to this important matter.

Yours very truly,
Coffing Hoists

David L. Benfield
Director of Sales & Marketing
Coffing Hoists